

Technical Service Bulletin (TSB) - VR1J45GGRJY057489	
D6AW0189Q0 : Version 2 of 18/02/2020	Cancel and replace the document of 13/06/2019
FOR : DS 7 CROSSBACK (X74) AND FRONTDS 7 CROSSBACK (X74)REAR RADAR OBSTACLE SENSOR	
CUSTOMER SYMPTOM :	INFORMATION : POOR VISIBILITY OF THE IMAGE TRANSMITTED BY THE VISUAL MANOEUVRING ASSISTANCE CAMERA AND/OR THE VISUAL REVERSING ASSISTANCE CAMERA 180°
CONDITIONS IN WHICH FAULT APPEARS :	WHILE MANOEUVRING AND REVERSING IN LOW LIGHT CONDITIONS

1. ORIGIN

Specification of the product.

2. Service Action

None.

2.1. Information

Pixellation and/or degradation of the image definition is possible due to exterior low-visibility.

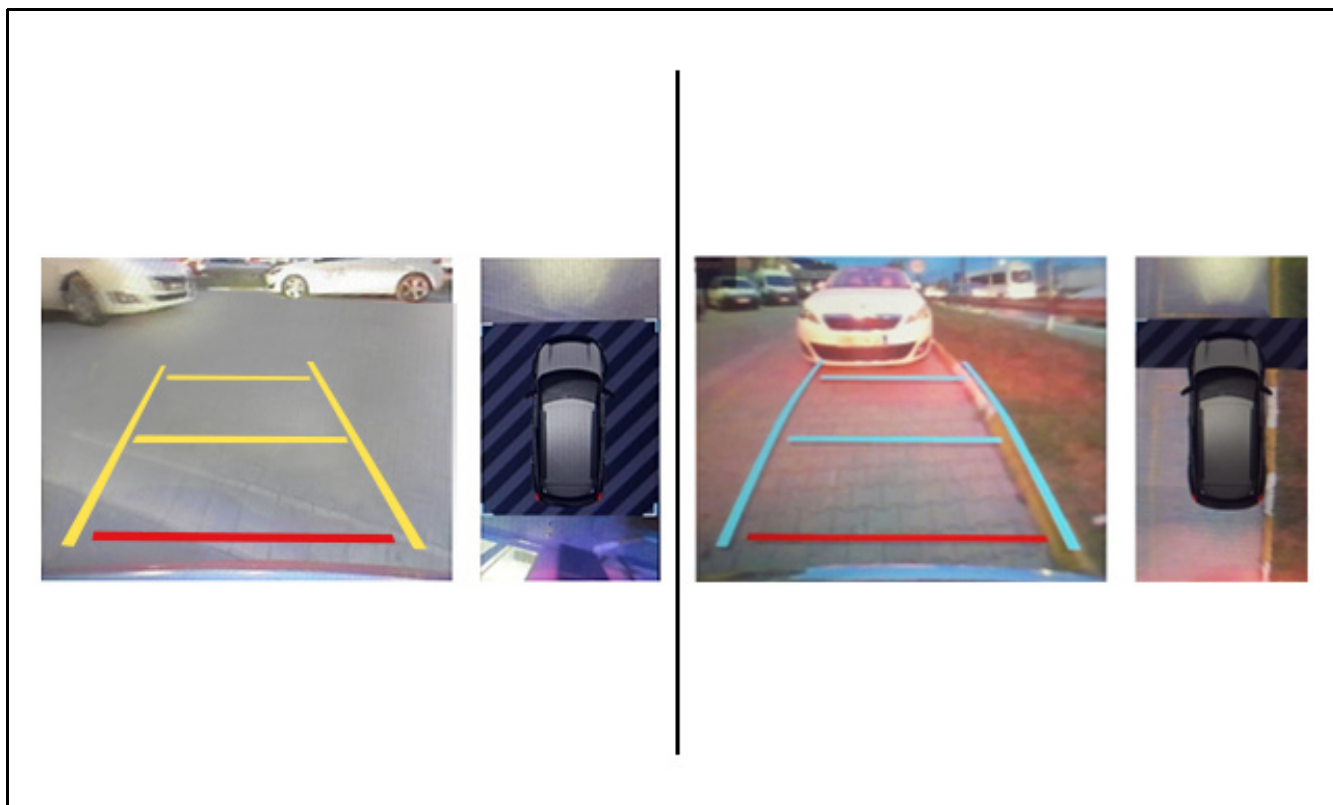


Figure : D6AW05UD

The illustrations above conform to the expected image definition.

CAUTION : Check that the visual manoeuvring assistance camera and/or the visual reversing assistance camera 180° are clean before confirming the image quality

Explain the phenomenon to the customer.

The operation conforms to specification ; Do not replace parts.

N.B. : The brightness of the multifunction screen may need to be set/adjusted to optimise the image quality

2.2. Labour time

No invoicing is to be applied for this bulletin.