

Technical Service Bulletin (TSB) - VR1J45GGRJY057489	
D6AW01AWQ0 : Version 0 of 20/11/2018	
FOR : DS 7 CROSSBACK (X74)	
CUSTOMER SYMPTOM :	THE MESSAGE FUNCTION (DRIVER'S SEAT) DOES NOT WORK
CONDITIONS IN WHICH FAULT APPEARS :	WHEN THERE IS AN OPERATION REQUEST FROM THE DRIVER

1. ORIGIN

Poor connection of the connector on the driver's seat pneumatic functions ECU.

2. Service Action

Check the connection of the black 10-way connector of the electrical harness on the driver's seat pneumatic functions ECU.

2.1. Check

Remove the rear shell of the front seat .

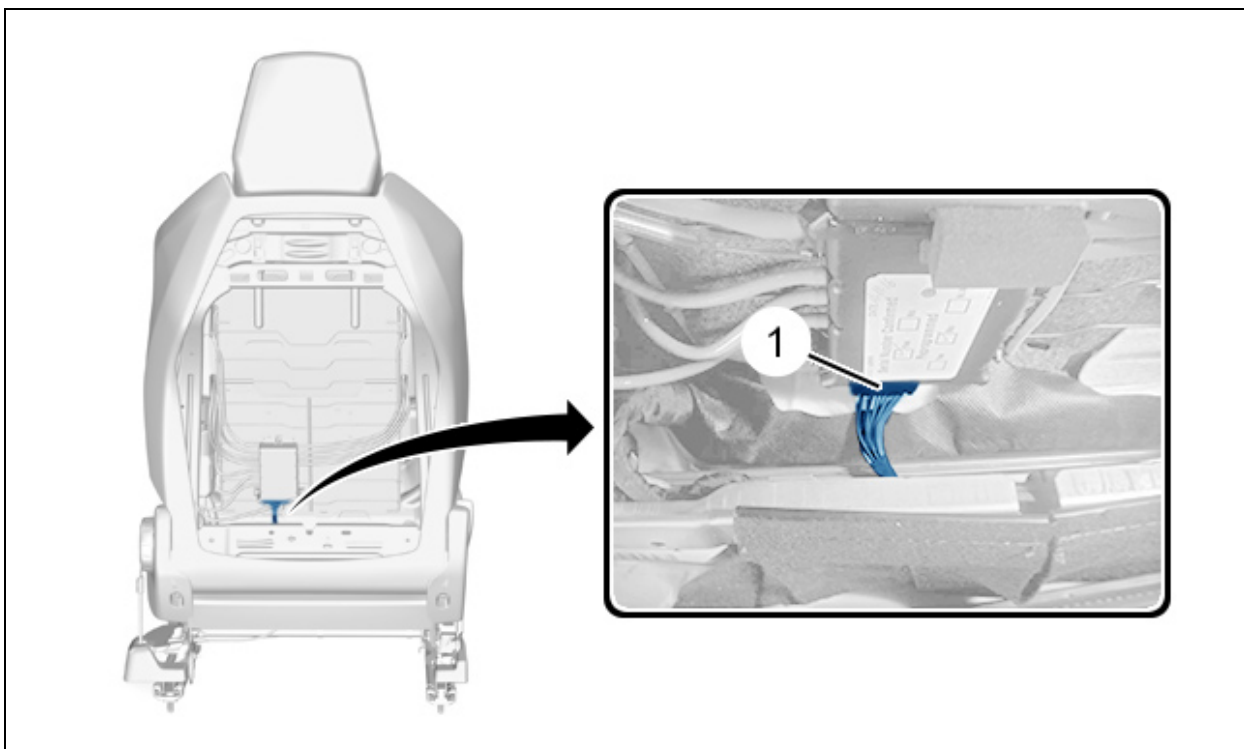


Figure : D6AW083D

Check the connection of the connector (1) :

- If connector (1) is wrongly connected : Carry out repair
- If the connector (1) is properly connected : Do not apply this document ; Carry out in-depth fault finding

2.2. Repair

Connect the connector (1).

Refit the rear shell of the front seat.

2.3. Labour time

DS 7 CROSSBACK (X74)

Invoicing time : 0,50H.

Operation code : 9R04RP00.

Cause code : 892D.

N.B. : Send a Dealer Issue Detection Incident (DID I) in the event of any recurrence following the application of this document